Trunk Unit CD Changer Magazine Won't Eject

(Supersedes 92-026, dated October 2, 1992)

PROBLEM

The CD changer magazine will not eject from the changer.

CORRECTIVE ACTION

Replace the magazine in the changer, and any other Honda magazines the customer may have, with the improved magazine. See PARTS INFORMATION.

NOTE: Do not replace the CD changer for this problem. The improved magazine(s) will prevent future jamming.

1. Remove the CD changer from the car.
2. Remove the side covers and the top case.
3. Slide a slim jim or a stainless steel ruler between the lower side of the CD magazine and the changer.
4. Push the eject lever toward the back of the unit while pulling the magazine out of the front opening.

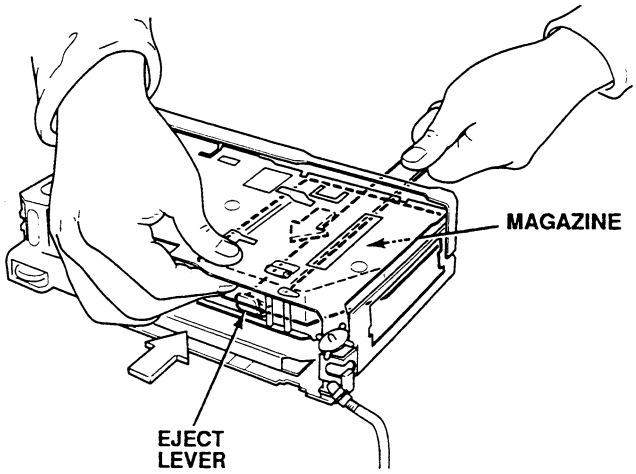

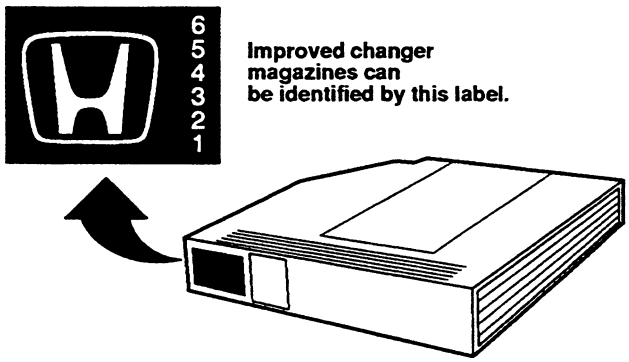

5. Reassemble the CD changer.
6. Reinstall the changer in the car.
7. Replace the changer magazine with the new part.

PARTS INFORMATION

CD Changer Magazine
P/N 08A06-121-41106 [redacted]

WARRANTY CLAIM INFORMATION

In warranty: The normal warranty applies.

Operation Number:	011130
Flat Rate Time:	0.5 hour
Failed Part:	P/N 08A06-102-410-06
Defect Code:	030
Contention Code:	F36

Out of warranty: Any repair performed after warranty expiration may be eligible for goodwill consideration by the District Service Manager or your Zone Office. You must request consideration, and get a decision, before starting work.

© 1993 American Honda Motor Co., Inc. – All Rights Reserved

CUSTOMER INFORMATION: The information in this bulletin is intended for use only by skilled technicians who have the proper tools, equipment, and training to correctly and safely maintain your vehicle. These procedures should not be attempted by "do-it-yourselfers," and you should not assume this bulletin applies to your vehicle, or that your vehicle has the condition described. To determine whether this information applies, contact an authorized Honda automobile dealer.